

ANALYTICAL REPORT

Eurofins Calscience LLC
7440 Lincoln Way
Garden Grove, CA 92841
Tel: (714)895-5494

Laboratory Job ID: 570-77793-1

Client Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

For:

Eurofins Eaton Analytical
750 Royal Oaks Drive
Monrovia, California 91016

Attn: Jaclyn Contreras



Authorized for release by:
12/9/2021 6:45:09 PM

Xuan Dang, Project Manager I
(714)895-5494
Xuan.Dang@eurofinset.com

LINKS

Review your project
results through
TotalAccess

Have a Question?



Visit us at:

www.eurofinsus.com/Env

The test results in this report meet all 2003 NELAC, 2009 TNI, and 2016 TNI requirements for accredited parameters, exceptions are noted in this report. This report may not be reproduced except in full, and with written approval from the laboratory. For questions please contact the Project Manager at the e-mail address or telephone number listed on this page.

This report has been electronically signed and authorized by the signatory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

Results relate only to the items tested and the sample(s) as received by the laboratory.

Table of Contents

Cover Page	1
Table of Contents	2
Definitions/Glossary	3
Case Narrative	4
Detection Summary	5
Client Sample Results	6
Surrogate Summary	8
QC Sample Results	9
QC Association Summary	10
Lab Chronicle	11
Certification Summary	12
Method Summary	13
Sample Summary	14
Chain of Custody	15
Receipt Checklists	20



Definitions/Glossary

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
□	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Job ID: 570-77793-1

Laboratory: Eurofins Calscience LLC

Narrative

Job Narrative 570-77793-1

Comments

No additional comments.

Receipt

The samples were received on 12/7/2021 10:20 AM. Unless otherwise noted below, the samples arrived in good condition, and where required, properly preserved and on ice. The temperature of the cooler at receipt was 3.9° C.

GC Semi VOA

No analytical or quality issues were noted, other than those described in the Definitions/Glossary page.

Organic Prep

No analytical or quality issues were noted, other than those described in the Definitions/Glossary page.

Detection Summary

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Client Sample ID: 202112080185

Lab Sample ID: 570-77793-1

Analyte	Result	Qualifier	RL	Unit	Dil Fac	D	Method	Prep Type
C9-C10	20000		2400	ug/L	50		8015B	Total/NA
C11-C12	66000		2400	ug/L	50		8015B	Total/NA
C13-C14	47000		2400	ug/L	50		8015B	Total/NA
C15-C16	10000		2400	ug/L	50		8015B	Total/NA
C17-C18	3100		2400	ug/L	50		8015B	Total/NA
C6-C44	140000		2400	ug/L	50		8015B	Total/NA
Gasoline Range Organics [C6 - C10]	20000		2400	ug/L	50		8015B	Total/NA
Diesel Range Organics [C10-C28]	140000		2400	ug/L	50		8015B	Total/NA

Client Sample ID: 202112080186

Lab Sample ID: 570-77793-2

Analyte	Result	Qualifier	RL	Unit	Dil Fac	D	Method	Prep Type
C6-C44	63		49	ug/L	1		8015B	Total/NA
Oil Range Organics (C28-C40)	49		49	ug/L	1		8015B	Total/NA

This Detection Summary does not include radiochemical test results.

Eurofins Calscience LLC

Client Sample Results

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Method: 8015B - Diesel Range Organics (DRO) (GC)

Client Sample ID: 202112080185

Date Collected: 12/05/21 14:00

Date Received: 12/07/21 10:20

Lab Sample ID: 570-77793-1

Matrix: Water

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
C6 as C6	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C7 as C7	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C8 as C8	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C9-C10	20000		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C11-C12	66000		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C13-C14	47000		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C15-C16	10000		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C17-C18	3100		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C19-C20	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C21-C22	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C23-C24	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C25-C28	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C29-C32	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C33-C36	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C37-C40	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C41-C44	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
C6-C44	140000		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
Gasoline Range Organics [C6 - C10]	20000		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
Diesel Range Organics [C10-C28]	140000		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
Oil Range Organics (C28-C40)	ND		2400	ug/L		12/08/21 09:47	12/09/21 15:54	50
Surrogate	%Recovery	Qualifier	Limits			Prepared	Analyzed	Dil Fac
n-Octacosane (Surr)	91		53 - 151			12/08/21 09:47	12/09/21 15:54	50

Client Sample ID: 202112080186

Date Collected: 12/05/21 15:24

Date Received: 12/07/21 10:20

Lab Sample ID: 570-77793-2

Matrix: Water

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
C6 as C6	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C7 as C7	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C8 as C8	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C9-C10	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C11-C12	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C13-C14	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C15-C16	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C17-C18	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C19-C20	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C21-C22	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C23-C24	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C25-C28	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C29-C32	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C33-C36	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C37-C40	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C41-C44	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
C6-C44	63		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
Gasoline Range Organics [C6 - C10]	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
Diesel Range Organics [C10-C28]	ND		49	ug/L		12/08/21 09:47	12/08/21 17:07	1
Oil Range Organics (C28-C40)	49		49	ug/L		12/08/21 09:47	12/08/21 17:07	1

Eurofins Calscience LLC

Client Sample Results

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Method: 8015B - Diesel Range Organics (DRO) (GC) (Continued)

<u>Surrogate</u>	<u>%Recovery</u>	<u>Qualifier</u>	<u>Limits</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Dil Fac</u>
n-Octacosane (Surr)	98		53 - 151	12/08/21 09:47	12/08/21 17:07	1

Surrogate Summary

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Method: 8015B - Diesel Range Organics (DRO) (GC)

Matrix: Water

Prep Type: Total/NA

Percent Surrogate Recovery (Acceptance Limits)

Lab Sample ID	Client Sample ID	OTCSN1 (53-151)
570-77793-1	202112080185	91
570-77793-2	202112080186	98
LCS 570-199439/2-A	Lab Control Sample	97
LCSD 570-199439/3-A	Lab Control Sample Dup	94
MB 570-199439/1-A	Method Blank	94

Surrogate Legend

OTCSN = n-Octacosane (Surr)

QC Sample Results

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Method: 8015B - Diesel Range Organics (DRO) (GC)

Lab Sample ID: MB 570-199439/1-A

Matrix: Water

Analysis Batch: 199489

Client Sample ID: Method Blank

Prep Type: Total/NA

Prep Batch: 199439

Analyte	MB Result	MB Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
C6 as C6	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C7 as C7	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C8 as C8	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C9-C10	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C11-C12	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C13-C14	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C15-C16	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C17-C18	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C19-C20	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C21-C22	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C23-C24	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C25-C28	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C29-C32	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C33-C36	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C37-C40	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C41-C44	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
C6-C44	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
Gasoline Range Organics [C6 - C10]	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
Diesel Range Organics [C10-C28]	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1
Oil Range Organics (C28-C40)	ND		50	ug/L		12/08/21 09:47	12/08/21 13:16	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
n-Octacosane (Surr)	94		53 - 151	12/08/21 09:47	12/08/21 13:16	1

Lab Sample ID: LCS 570-199439/2-A

Matrix: Water

Analysis Batch: 199489

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Prep Batch: 199439

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec. Limits
Diesel Range Organics [C10-C28]	4000	4632		ug/L		116	70 - 131

Surrogate	LCS %Recovery	LCS Qualifier	Limits
n-Octacosane (Surr)	97		53 - 151

Lab Sample ID: LCSD 570-199439/3-A

Matrix: Water

Analysis Batch: 199489

Client Sample ID: Lab Control Sample Dup

Prep Type: Total/NA

Prep Batch: 199439

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec. Limits	RPD	RPD Limit
Diesel Range Organics [C10-C28]	4000	4573		ug/L		114	70 - 131	1	20

Surrogate	LCSD %Recovery	LCSD Qualifier	Limits
n-Octacosane (Surr)	94		53 - 151

QC Association Summary

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

GC Semi VOA

Prep Batch: 199439

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
570-77793-1	202112080185	Total/NA	Water	3510C	
570-77793-2	202112080186	Total/NA	Water	3510C	
MB 570-199439/1-A	Method Blank	Total/NA	Water	3510C	
LCS 570-199439/2-A	Lab Control Sample	Total/NA	Water	3510C	
LCSD 570-199439/3-A	Lab Control Sample Dup	Total/NA	Water	3510C	

Analysis Batch: 199489

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
570-77793-2	202112080186	Total/NA	Water	8015B	199439
MB 570-199439/1-A	Method Blank	Total/NA	Water	8015B	199439
LCS 570-199439/2-A	Lab Control Sample	Total/NA	Water	8015B	199439
LCSD 570-199439/3-A	Lab Control Sample Dup	Total/NA	Water	8015B	199439

Analysis Batch: 199804

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
570-77793-1	202112080185	Total/NA	Water	8015B	199439

Lab Chronicle

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Client Sample ID: 202112080185

Lab Sample ID: 570-77793-1

Date Collected: 12/05/21 14:00

Matrix: Water

Date Received: 12/07/21 10:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	3510C			260.9 mL	2.5 mL	199439	12/08/21 09:47	UFLU	ECL 1
Total/NA	Analysis	8015B		50			199804	12/09/21 15:54	N5Y3	ECL 1
Instrument ID: GC48										

Client Sample ID: 202112080186

Lab Sample ID: 570-77793-2

Date Collected: 12/05/21 15:24

Matrix: Water

Date Received: 12/07/21 10:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	3510C			255.6 mL	2.5 mL	199439	12/08/21 09:47	UFLU	ECL 1
Total/NA	Analysis	8015B		1			199489	12/08/21 17:07	N5Y3	ECL 1
Instrument ID: GC48										

Laboratory References:

ECL 1 = Eurofins Calscience LLC Lincoln, 7440 Lincoln Way, Garden Grove, CA 92841, TEL (714)895-5494

Accreditation/Certification Summary

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Laboratory: Eurofins Calscience LLC

The accreditations/certifications listed below are applicable to this report.

Authority	Program	Identification Number	Expiration Date
California	State	2944	09-30-22
Oregon	NELAP	CA300001	01-30-22

1

2

3

4

5

6

7

8

9

10

11

12

13

14

15

Method Summary

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Method	Method Description	Protocol	Laboratory
8015B	Diesel Range Organics (DRO) (GC)	SW846	ECL 1
3510C	Liquid-Liquid Extraction (Separatory Funnel)	SW846	ECL 1

Protocol References:

SW846 = "Test Methods For Evaluating Solid Waste, Physical/Chemical Methods", Third Edition, November 1986 And Its Updates.

Laboratory References:

ECL 1 = Eurofins Calscience LLC Lincoln, 7440 Lincoln Way, Garden Grove, CA 92841, TEL (714)895-5494

Sample Summary

Client: Eurofins Eaton Analytical
Project/Site: 973582 - RED-HILL-INCIDENT (Red Hill)

Job ID: 570-77793-1

Lab Sample ID	Client Sample ID	Matrix	Collected	Received
570-77793-1	202112080185	Water	12/05/21 14:00	12/07/21 10:20
570-77793-2	202112080186	Water	12/05/21 15:24	12/07/21 10:20

1

2

3

4

5

6

7

8

9

10

11

12

13

14

15



Eaton Analytical

Ship To:

**Eurofins CalScience
7440 Lincoln Way**

Garden Grove, CA 92641-1432

Phone: 714-895-5494 Fax: 714-894-7501

Folder #:
973582

Report Due:
12/21/2021

Submittal Form

Date: 12/8/2021

***REPORTING REQUIREMENTS: Do Not Combine Reports with any other samples submitted under different Folder Numbers!**

Report & Invoice must have the Folder # **973582** Job # **1000014**

Report all quality control data according to Method. Include dates analyzed. Date extracted (if extracted) and Method reference on the report. Results must have Complete data & QC with Approval Signature.

Reports: Jackie Contreras Sub-Contracting Administrator
EMAIL TO: Eaton-MonroviaSubContract@eurofinset.com
Eurofins Eaton Analytical, LLC 750 Royal Oaks Drive, Suite 100, Monrovia, CA 91016
Phone (626) 386-1165 Fax (626) 386-1122
Invoices to: Eurofins Eaton Analytical, LLC
Accounts Payable 2425 New Holland Pike, Lancaster, PA 17605

Provide in each Report the
Specified State Certification # and
Exp Date for requested tests + matrix.

Samples from: **HAWAII**

rush

Sample ID	Client Sample ID for reference onl	Sample Date & Time	Matrix	Clip Code	PWSID
202112080185	Red Hill Shaft	12/05/21 1400	water		JLS

Sample type:	Sample Event:	Facility ID:	Sample Point ID:	Static ID: Extractable
--------------	---------------	--------------	------------------	------------------------

Method	Prep Method	Analysis Requested
8015B	EPA 3510C	Gas, Diesel, and Motor Oil Organics
8015B M	EPA 3510C	6257_8015B(M) C6-C44

Sample ID	Client Sample ID for reference onl	Sample Date & Time	Matrix	Clip Code	PWSID
202112080186	Red Hill Upper Storage Tank	12/05/21 1524	water		JLS

Sample type:	Sample Event:	Facility ID:	Sample Point ID:	Static ID:
--------------	---------------	--------------	------------------	------------

Method	Prep Method	Analysis Requested
8015B	EPA 3510C	Gas, Diesel, and Motor Oil Organics
8015B M	EPA 3510C	6257_8015B(M) C6-C44

Relinquished by: _____ Sample Control Date _____ Time _____

Received by: _____ Date _____ Time _____

Relinquished by: _____ Sample Control Date _____ Time _____

Received by: _____ Date _____ Time _____

NOTIFICATION REQUIRED IF RECEIVED OUTSIDE OF 0-6 CELSIUS

An Acknowledgement of Receipt is requested to attn: Jackie Contreras

77793

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14
- 15

ORIGIN ID NAXA (808) 586-4258
SELA ARONI
DEPARTMENT OF HEALTH/SDWB
2385 WAIMANO HOME RD
ULUAKUPU BLDG. 4
PEARL CITY, HI 96782
UNITED STATES US

SHIP DATE 06DEC21
ACTWGT 20.00 LB
CAD 101971153/NET4400
DIMS 16x12x14 IN
BILL SENDER


TO **XUAN DANG**
EUROFINS CALSCIENCE
7440 LINCOLN WAY

GARDEN GROVE CA 92641
(714) 895-5494
INV REF

56DJ3/E934/FE4A

DEPT

PO

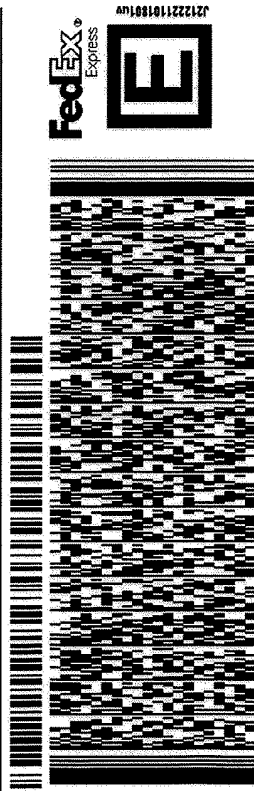

TUE - 07 DEC 11:30A
PRIORITY OVERNIGHT

3 of 8


MPS# **7754 0703 6964**

0263

Mstr# **7754 0703 7710**

92641
CA-US **SNA**

WZ APVA

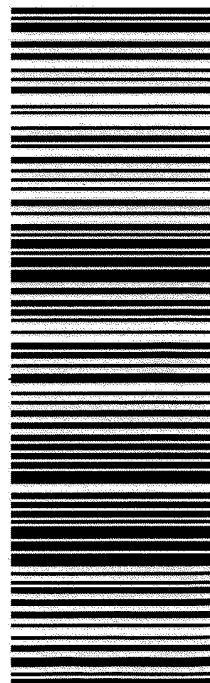

After printing this label
1 Use the 'Print' button on this page to print your label to your laser or inkjet printer
2 Fold the printed page along the horizontal line
3 Place label in shipping pouch and affix it to your shipment so that the barcode portion of the label can be read and scanned

Warning IMPORTANT. TRANSMIT YOUR SHIPPING DATA AND PRINT A MANIFEST
At the end of each shipping day, you should perform the FedEx Ground End of Day Close procedure to transmit your shipping data to FedEx. To do so, click on the Ground End of Day Close Button. If required, print the pickup manifest that appears. A printed manifest is required to be tendered along with your packages if they are being picked up by FedEx Ground. If you are dropping your packages off at a FedEx drop off location, the manifest is not required.
Use of this system constitutes your agreement to the service conditions in the current FedEx Service Guide and applicable tariff, available upon request. FedEx will not be responsible for any claim in excess of \$100 per package, whether the result of loss, damage, delay, non-delivery, misdelivery, or misinformation, unless you declare a higher value, pay an additional charge, document your actual loss and file a timely claim. Limitations, including limitations on our liability, can be found in the current FedEx Service Guide and applicable tariff apply. In no event shall FedEx Ground be liable for any special, incidental, or consequential damages, including, without limitation, loss of profit, loss to the intrinsic value of the package, loss of sale, interest income or attorney's fees. Recovery cannot exceed actual documented loss. Items of extraordinary value are subject to separate limitations of liability set forth in the Service Guide and tariff. Written claims must be filed within strict time limits, see current FedEx Service Guide.



570-77793 Waybill

77793



570-77793 Waybill

After printing this label

- 1 Use the 'Print' button on this page to print your label to your laser or inkjet printer
- 2 Fold the printed page along the horizontal line
3. Place label in shipping pouch and affix it to your shipment so that the barcode portion of the label can be read and scanned

Warning: IMPORTANT. TRANSMIT YOUR SHIPPING DATA AND PRINT A MANIFEST:

At the end of each shipping day, you should perform the FedEx Ground End of Day Close procedure to transmit your shipping data to FedEx. To do so, click on the Ground End of Day Close Button. If required, print the pickup manifest that appears. A printed manifest is required to be tendered along with your packages if they are being picked up by FedEx Ground. If you are dropping your packages off at a FedEx drop off location, the manifest is not required.

Use of this system constitutes your agreement to the service conditions in the current FedEx Service Guide and applicable tariff, available upon request. FedEx will not be responsible for any claim in excess of \$100 per package, whether the result of loss, damage, delay, non-delivery, misdelivery, or misinformation, unless you declare a higher value, pay an additional charge, document your actual loss and file a timely claim. Limitations, including incidental, or consequential damages, the current FedEx Service Guide and applicable tariff apply. In no event shall FedEx Ground be liable for any special, incidental, or consequential damages, including, without limitation, loss of profit, loss to the intrinsic value of the package, loss of sale, interest income or attorney's fees. Recovery cannot exceed actual documented loss. Items of extraordinary value are subject to separate limitations of liability set forth in the Service Guide and tariff. Written claims must be filed within strict time limits, see current FedEx Service Guide

ORIGIN ID: NAXA (808) 586-4258
SEILA ARONI
DEPARTMENT OF HEALTH/SDWB
2385 WAIMANO HOME RD
ULUKUPU BLDG. 4
PEARL CITY, HI 96782
UNITED STATES US

SHIP DATE: 06DEC21
ACTWGT: 20.00 LB
CAD: 101971153/NET14400
DIMS: 16x12x14 IN


BILL SENDER

TO **XUAN DANG**
EUROFINS CALSCIENCE
7440 LINCOLN WAY

GARDEN GROVE CA 92641

(714) 895-5494
PO INV REF

DEPT

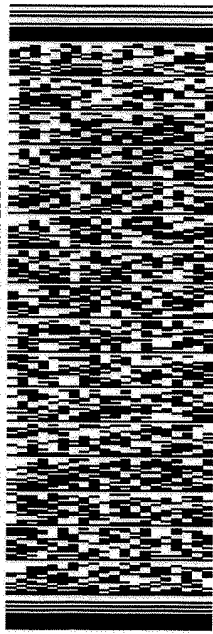

J21222110180714

TUE - 07 DEC 11:30A

PRIORITY OVERNIGHT

3 of 8

MPS# 7754 0703 6964

0263


Mstr# 7754 0703 7710

0201

92641

CA-US SNA

WZ APVA

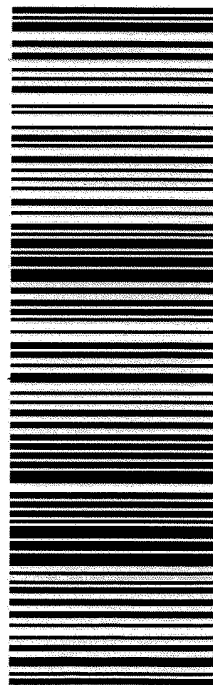

Login Sample Receipt Checklist

Client: Eurofins Eaton Analytical

Job Number: 570-77793-1

Login Number: 77793

List Number: 1

Creator: Vitente, Precy

List Source: Eurofins Calscience LLC

Question	Answer	Comment
Radioactivity wasn't checked or is $\leq$ background as measured by a survey meter.	True	
The cooler's custody seal, if present, is intact.	N/A	
Sample custody seals, if present, are intact.	True	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the containers received and the COC.	True	
Samples are received within Holding Time (excluding tests with immediate HTs)	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified.	True	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
Containers requiring zero headspace have no headspace or bubble is $<6\text{mm}$ (1/4").	True	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Residual Chlorine Checked.	N/A	