

DEPARTMENT OF THE NAVY

COMMANDER
NAVY REGION HAWAII
850 TICONDEROGA ST STE 110
JBPHH, HAWAII 96860-5101

5000-45A N45 September 7, 2021

CERTIFIED NO: 9489 0090 0027 6232 9872 76

Mr. Richard Takaba Hawaii State Department of Health Solid and Hazardous Waste Branch Underground Storage Tank Section 2827 Waimano Home Road #100 Pearl City, HI 96782

Dear Mr. Takaba:

SUBJECT: RED HILL TANK COMPLEX

SOIL VAPOR SAMPLING RESULTS FOR AUGUST 2021

DOH FACILITY ID NO. 9-102271

DOH RELEASE ID NO. 990051, 010011, 020028, 140010, AND 210012

Monthly soil vapor samples were collected on August 20, 2021 from beneath all accessible Red Hill tanks with the exception of Tanks 1 and 19 which are inactive and not included in the sampling network.

Soil vapor VOC concentrations were measured in the field using a photo-ionization detector. The soil vapor sampling results are presented graphically in an enclosure.

A conservative approach to assess the integrity of the associated tank system is to establish action thresholds for VOC concentrations in soil vapor monitoring points (SVMPs) beneath tanks as 50 percent of the calculated vapor concentration from fuel-saturated water. These action thresholds for SVMPs beneath tanks containing F-24 or JP-5 is 280,000 ppbv and 14,000 ppbv in SVMPs beneath tanks containing marine diesel fuel.

At Tank 5, the concentrations of VOCs detected in the front, middle and outer edge soil vapor monitoring probes were 379, 416, and 238 ppbv, respectively. VOC concentrations measured in all down-gradient tank soil vapor monitoring probes were 102 to 238 ppbv.

Additional supplemental monitoring is ongoing in response to the May 6, 2021 pipeline breach that occurred in the tunnel and is being reported separately.

All VOC concentrations measured in August were below the action levels, with no consistent trends observed over time.

5000-45A N45 September 7, 2021

Regular monthly soil vapor VOC concentrations will continue to be reported. The next monthly soil vapor sampling event will be scheduled for the week of September 13, 2021.

If there are any questions regarding this matter, or if more information is needed, please contact Ms. Susan Lohr at (808) 471-4619 or Ms. Dayna Fujimoto at (808) 471-4805.

Sincerely,

SHERRIR. ENG <

Director

Regional Environmental Department

By direction of the

Commander

Enclosure: Graphical Summary of Soil Vapor Sampling Results for Tanks 2 - 18 and 20

Data represented through August 2021 (18 pages)


Copy to: Mr. John Floyd, NAVSUP FLC Pearl Harbor

Electronic Copies to: Ms. Gabriela Carvalho, U.S. EPA Region 9, Red Hill Program Coordinator


Mr. John Reed, DLA Energy Pacific

Mr. William Potter, DLA Energy - Engineering, Environmental, Property

Directorate

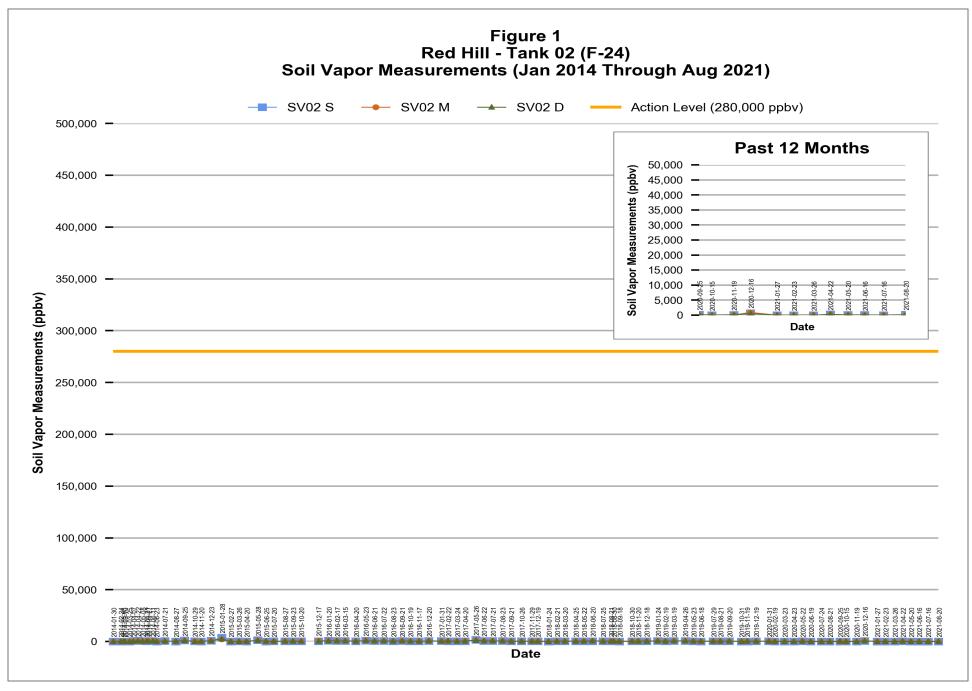


^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

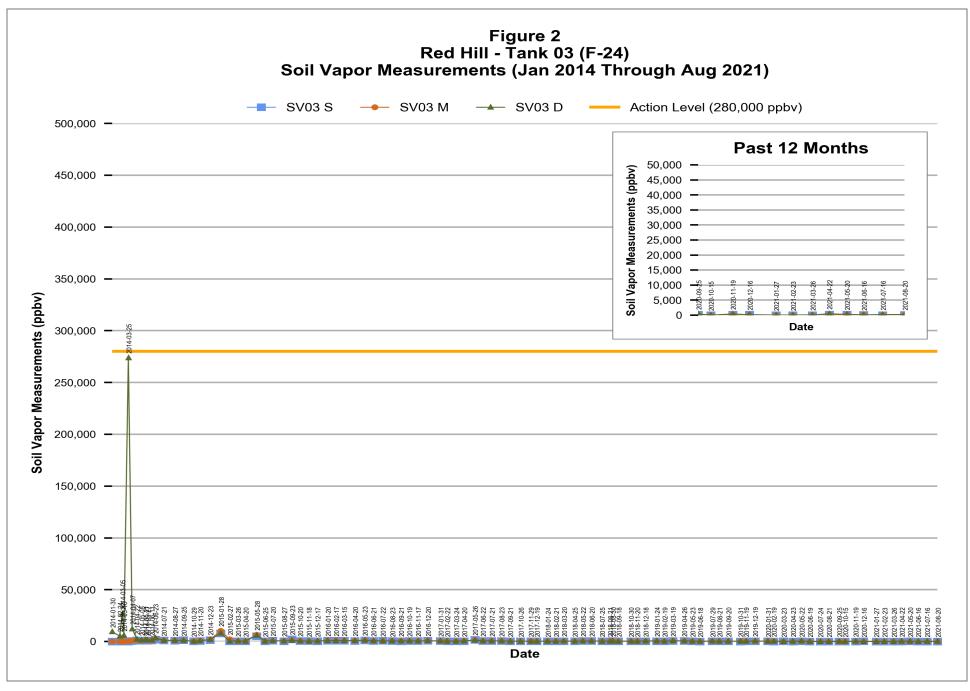


F-24: Jet Fuel, Fuel Number 24 F-76: Marine Diesel, Fuel Number 76

^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

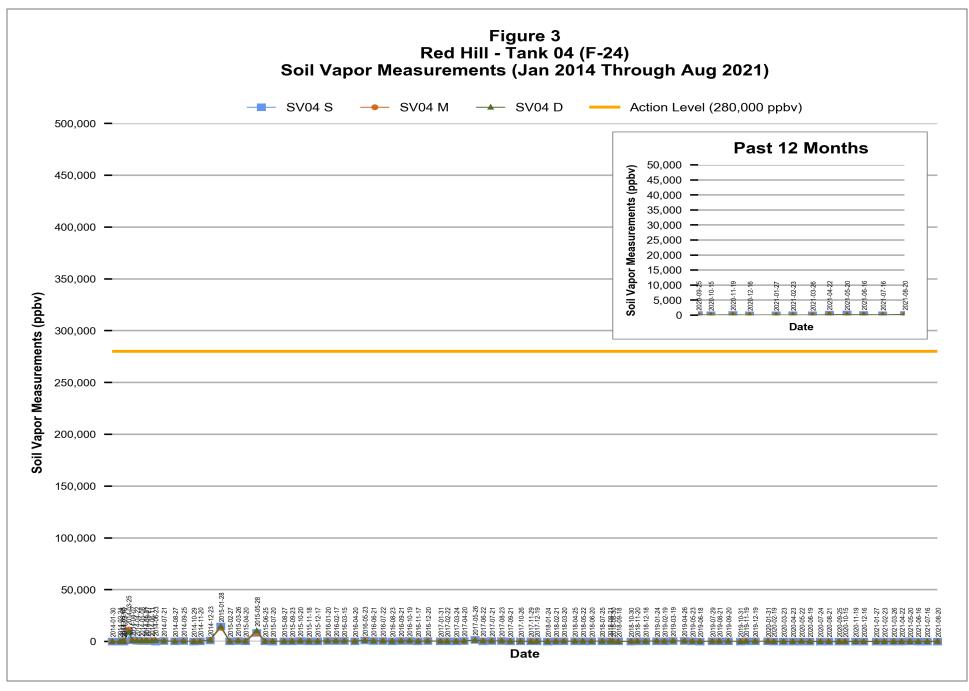


^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

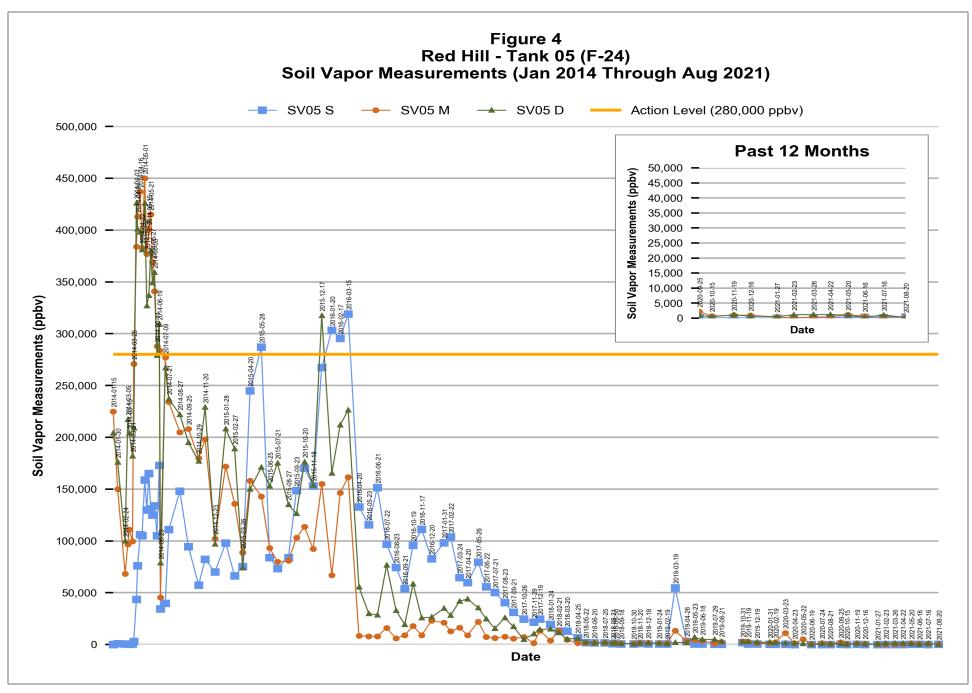

F-24: Jet Fuel, Fuel Number 24 F-76: Marine Diesel, Fuel Number 76

^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

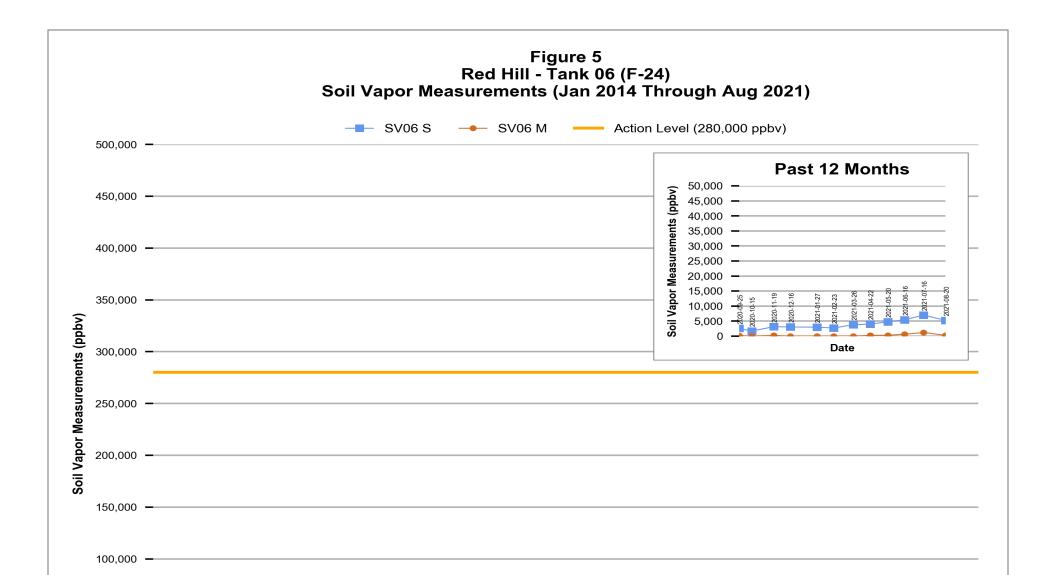




50,000

F-24: Jet Fuel, Fuel Number 24 F-76: Marine Diesel, Fuel Number 76

2016-01-20 2016-02-17 2016-02-12 2016-08-23 2016-08-23 2016-08-23 2016-08-23 2017-03-23 2018-03-23


Date

^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

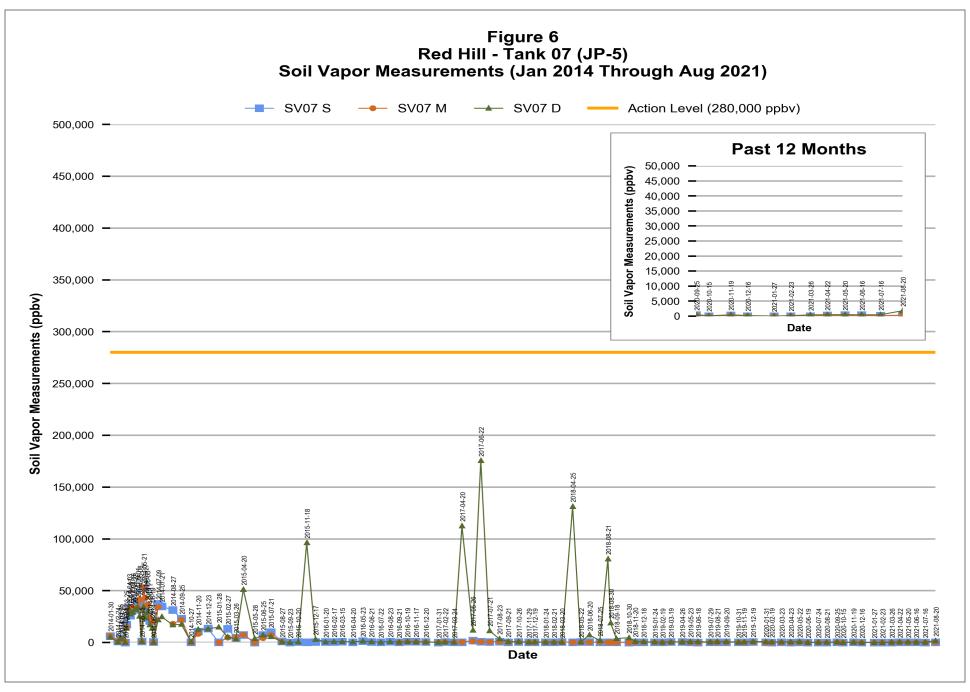


F-24: Jet Fuel, Fuel Number 24 F-76: Marine Diesel, Fuel Number 76


^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

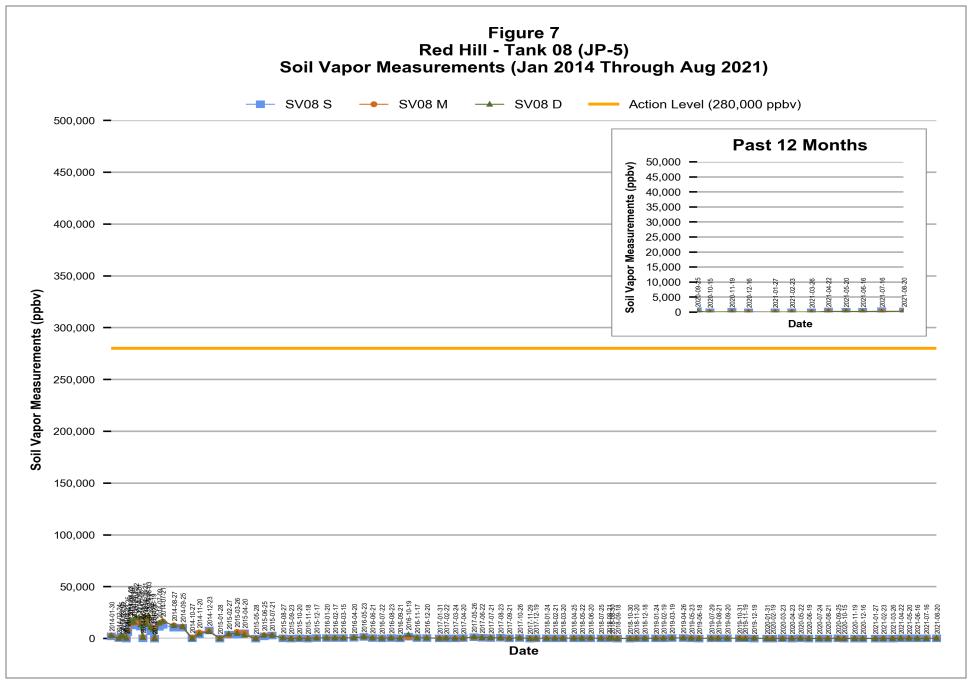


^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

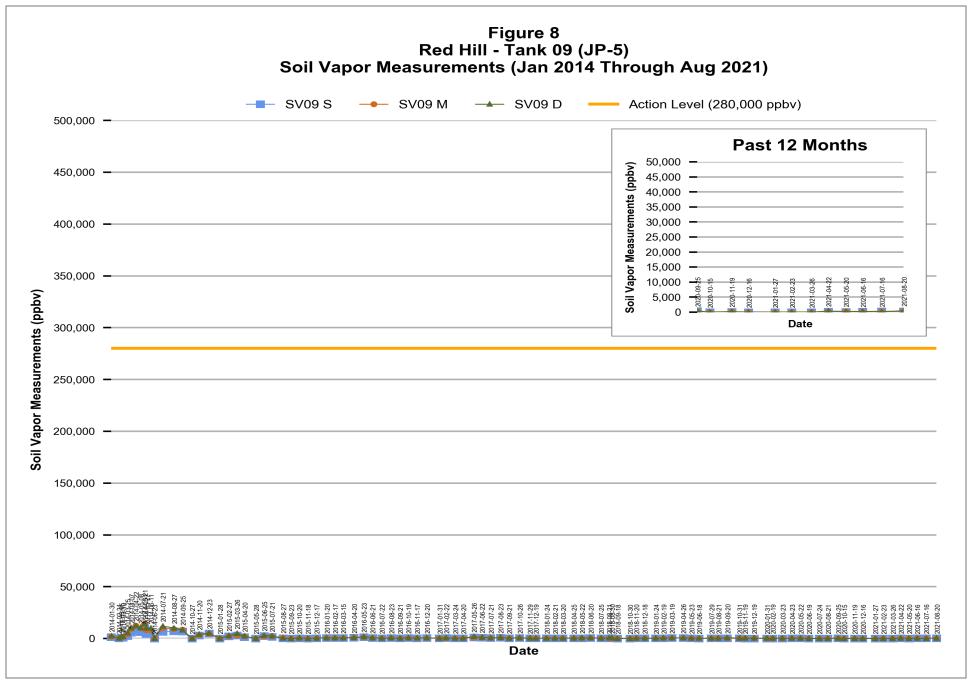


^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

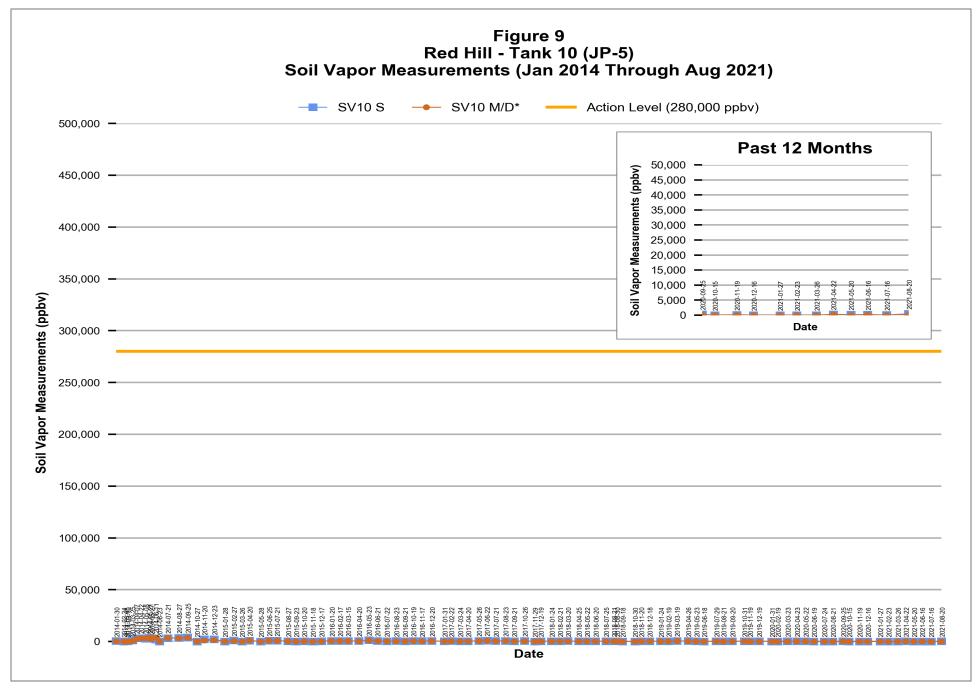


^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

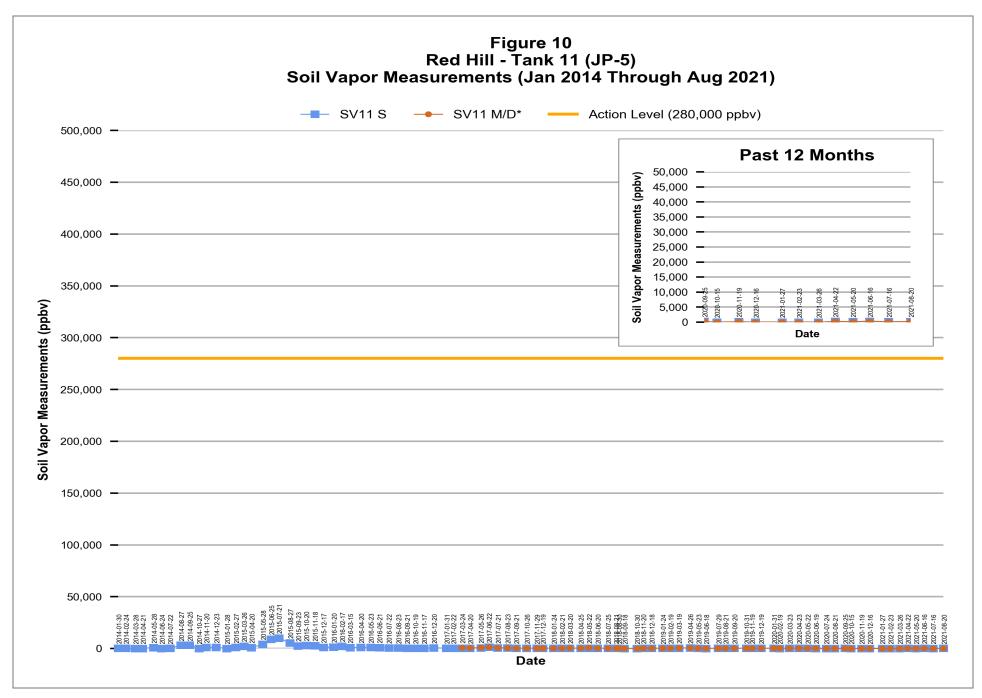

^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

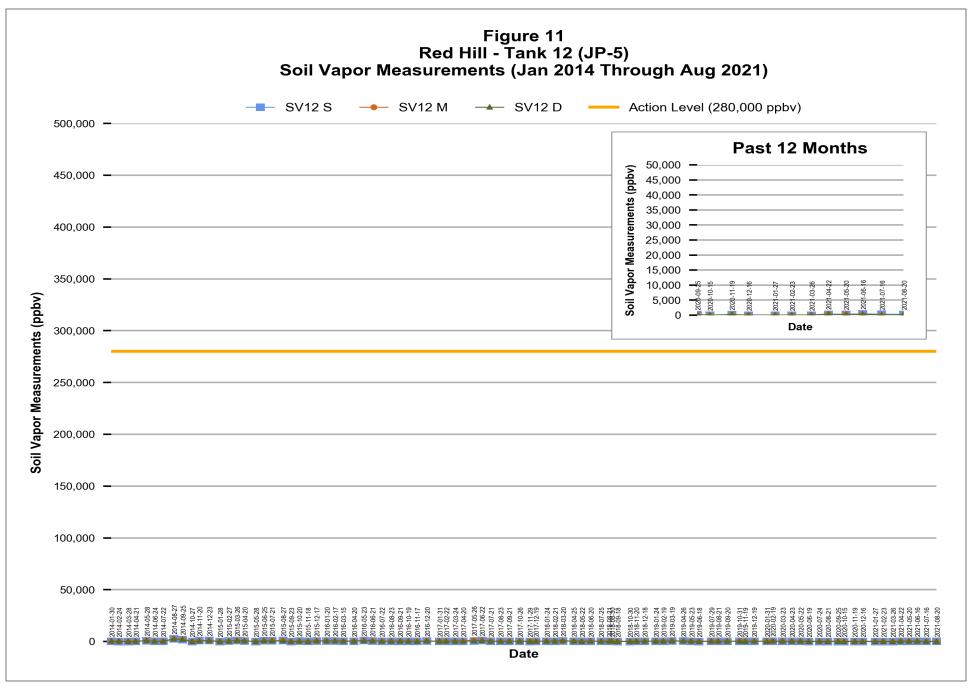


^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

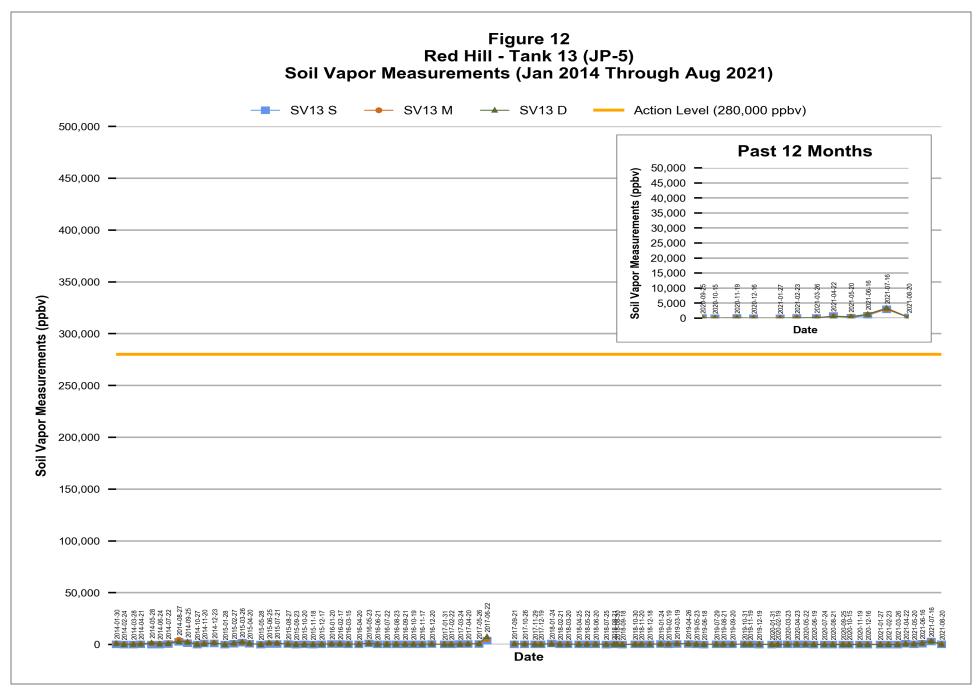

F-24: Jet Fuel, Fuel Number 24 F-76: Marine Diesel, Fuel Number 76 JP-5: Jet Fuel, Propellant Number 5 ppbv: Parts Per Billion by Volume

Tank 13 is empty and inactive, undergoing clean, inspect & repair (CIR), but remains accessible for soil vapor monitoring events.


^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

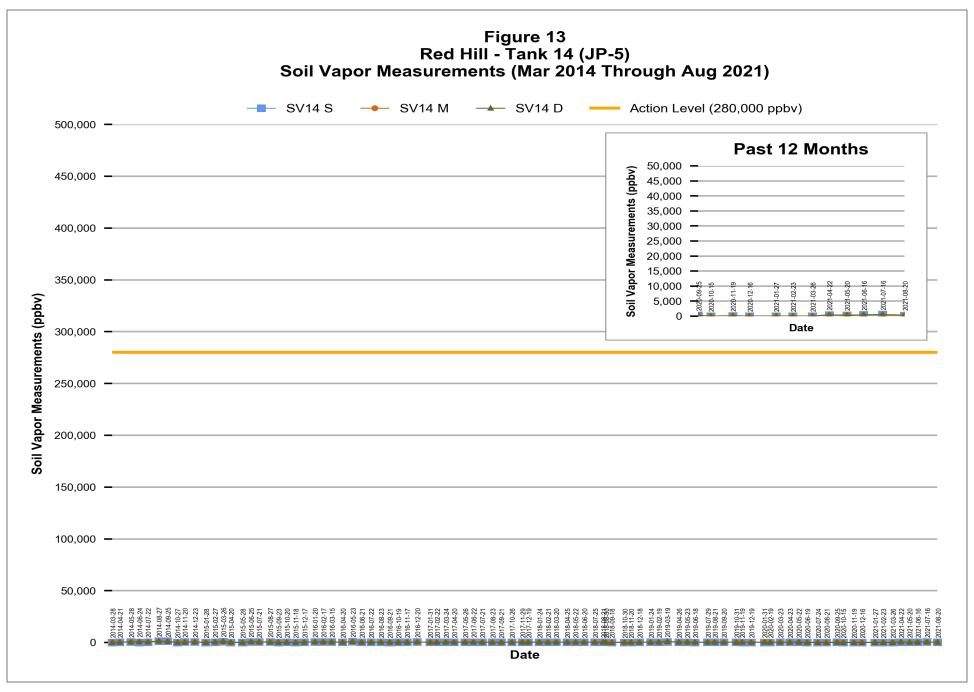

F-24: Jet Fuel, Fuel Number 24 F-76: Marine Diesel, Fuel Number 76 JP-5: Jet Fuel, Propellant Number 5 ppbv: Parts Per Billion by Volume


Tank 14 is empty and inactive, undergoing clean, inspect & repair (CIR), but remains accessible for soil vapor monitoring events.

^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

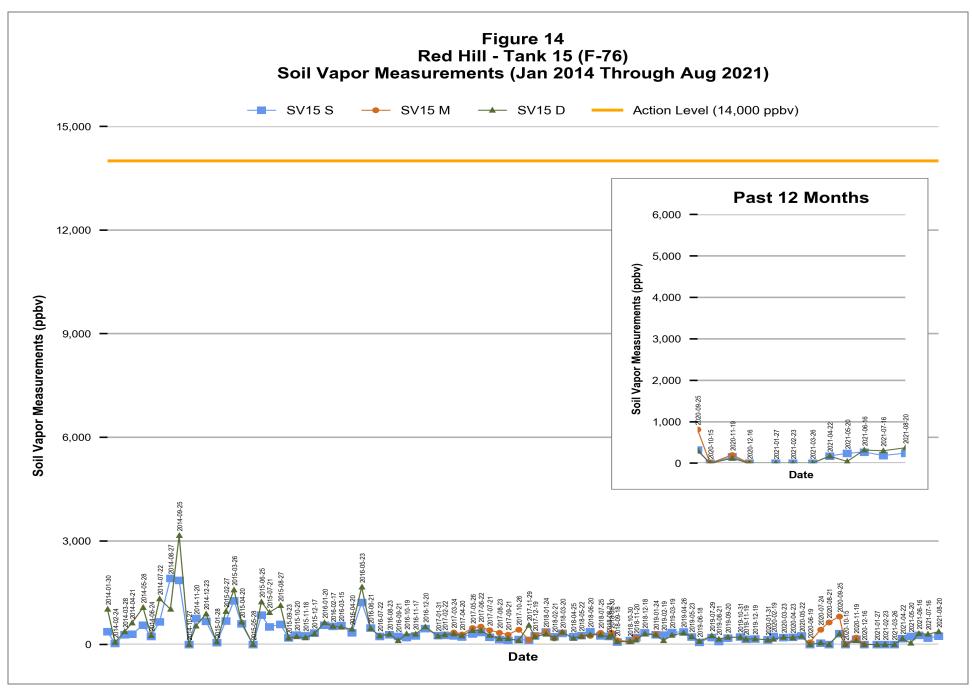


F-24: Jet Fuel, Fuel Number 24 F-76: Marine Diesel, Fuel Number 76

^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

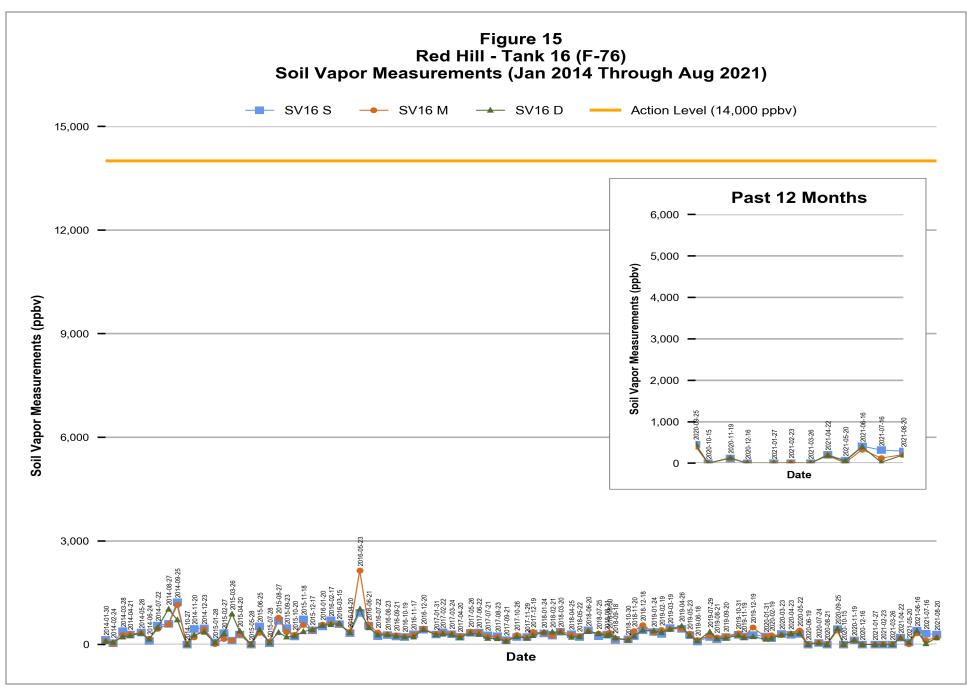

F-24: Jet Fuel, Fuel Number 24 F-76: Marine Diesel, Fuel Number 76


^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

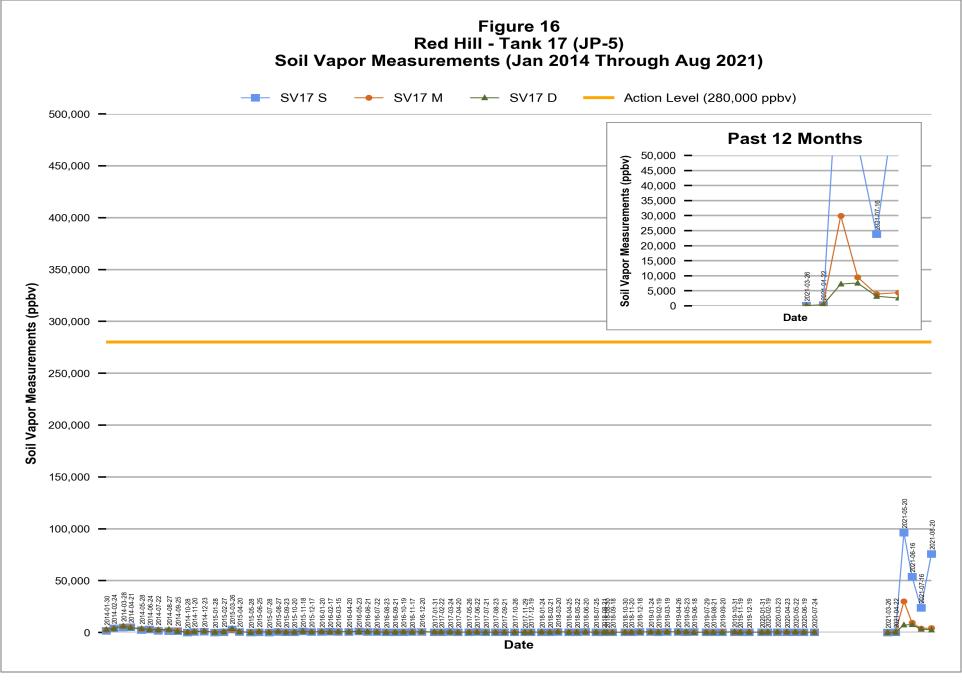

F-24: Jet Fuel, Fuel Number 24 F-76: Marine Diesel, Fuel Number 76 JP-5: Jet Fuel, Propellant Number 5 ppbv: Parts Per Billion by Volume

Tank 17 is empty and inactive, undergoing clean, inspect & repair (CIR), but remains accessible for soil vapor monitoring events.


^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

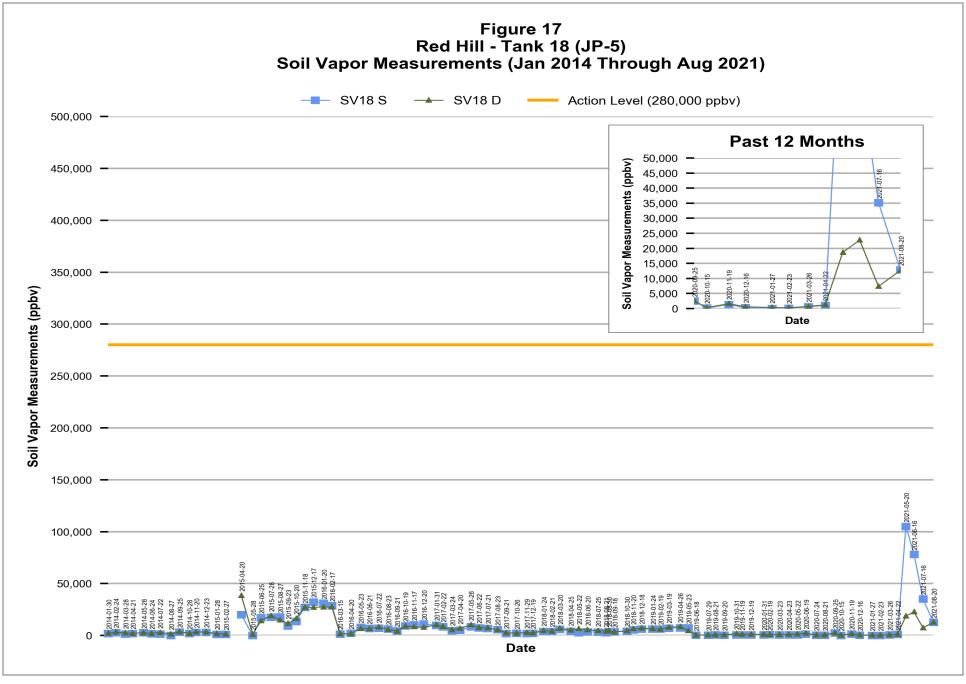

F-24: Jet Fuel, Fuel Number 24 F-76: Marine Diesel, Fuel Number 76 JP-5: Jet Fuel, Propellant Number 5 ppbv: Parts Per Billion by Volume

Tank 18 is empty and inactive, undergoing clean, inspect & repair (CIR), but remains accessible for soil vapor monitoring events.

^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.

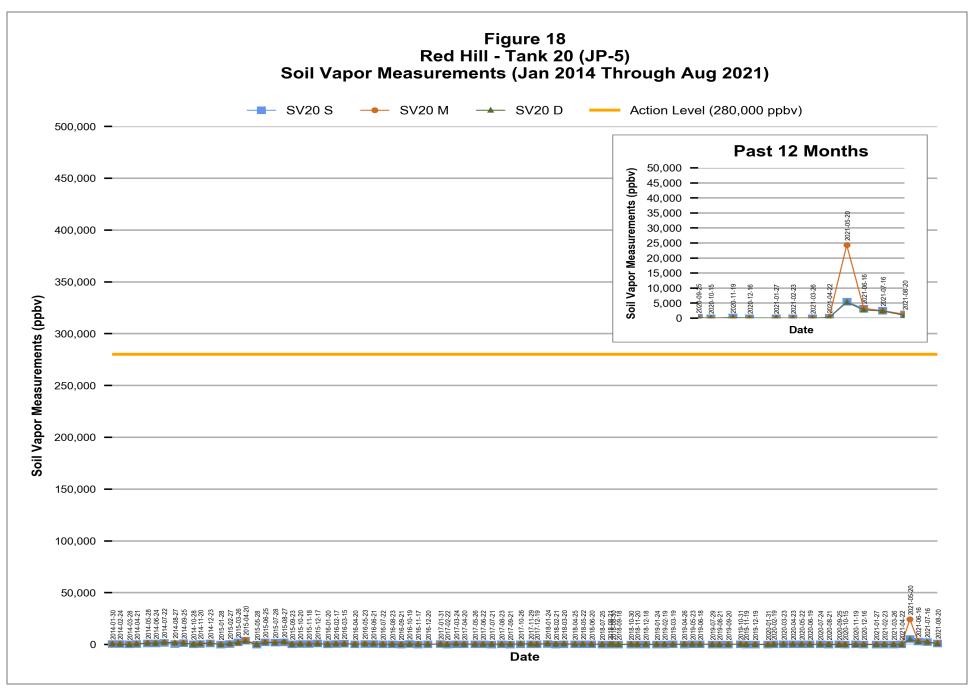

^{* &}quot;M/D" monitoring points were constructed to screen both middle & deep depth intervals along the respective underground storage tank.